CORNER RECORD

City of

Document Number_____

County of Madera California

Brief Legal Description NE Cor. Sec. 5, T. 10 S., R. 22 E., M.D.M.

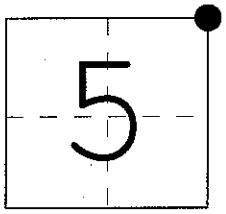

CORNER TYPE

Government Corner	[X]	Control	[ ]
Meander	[ ]	Property	[ ]
Rancho	[ ]	Other	[ ]

Date of Survey
March 13, 2002

COORDINATES (optional)

N. 1859226.4

E. 6827803.8

Epoch 1998.5

NAD83

Zone 3

Corner: Left as Found [X] Established [ ] Reestablished [ ] Rebuilt [ ] Remon. [ ] Amended [ ]

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:

NE Cor. Sec. 5, T. 10 S., R. 22 E., M.D.M. This corner set by W.O. Gentry, LS 2737, dated 1964, is a perpetuation of the original corner. Found one remaining original bearing tree and remains of another original bearing tree a local bearing object to verify the corner and accept it.

A description of the physical condition of the monument as found and as set or reset.

Found 2 1/2 in. diam. iron pipe, with brass disk, firmly set, flush with top of a mound of stone, 7 ft. base, 3 ft. high at the S edge of Kennedy table.

SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with the Land Surveyor's Act on Feb. 12 2004

Signed [signature] L.S. or R.C.E Number_____

COUNTY SURVEYOR'S STATEMENT

This Corner Record was received Feb 13 2004 and examined and filed Feb 18 2004.

Signed David McGlasson Title ACTING CO. SURVEYOR

County Surveyor's Comment

Refer to Bureau of Land Management, California State Office, Official Survey, Group 1357, T. 10 S., R. 22 E., Mount Diablo Meridian, March 13, 2002, Volume R 606, Page 42-43.

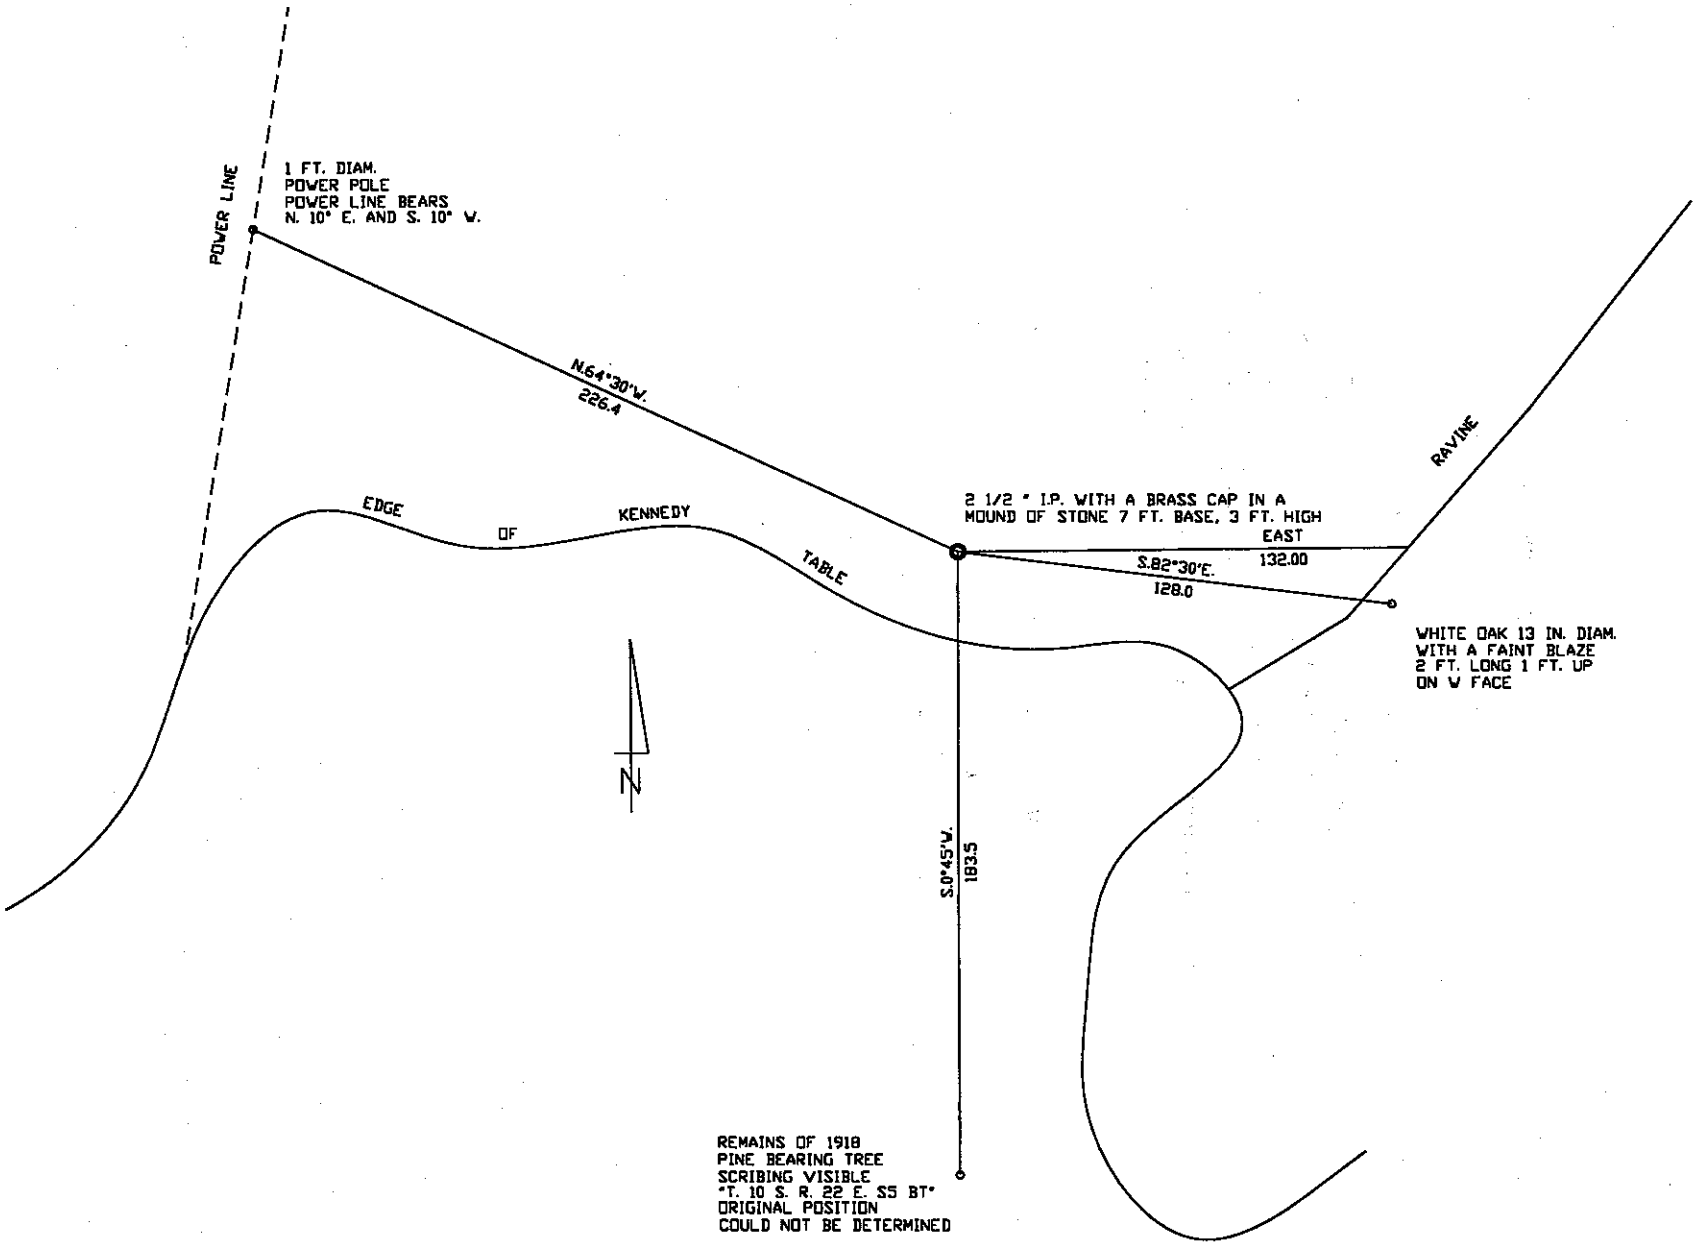
POWER LINE
1 FT. DIAM.
POWER POLE
POWER LINE BEARS
N. 10° E. AND S. 10° W.
N.64°30'W.
226.4
EDGE
OF
KENNEDY
TABLE
2 1/2 " I.P. WITH A BRASS CAP IN A
MOUND OF STONE 7 FT. BASE, 3 FT. HIGH
EAST
132.00
S.82°30'E.
128.0
RAVINE
WHITE OAK 13 IN. DIAM.
WITH A FAINT BLAZE
2 FT. LONG 1 FT. UP
ON W FACE
N
S.0°45'W.
183.5
REMAINS OF 1918
PINE BEARING TREE
SCRIBING VISIBLE
"T. 10 S. R. 22 E. S5 BT"
ORIGINAL POSITION
COULD NOT BE DETERMINED